

P62

Heavy-duty pneumatic clamps

P62 is a heavy-duty pneumatic clamp for fixture workholding. Compressed-air actuation secures the part; select the model according to the documented capacity and mounting dimensions.



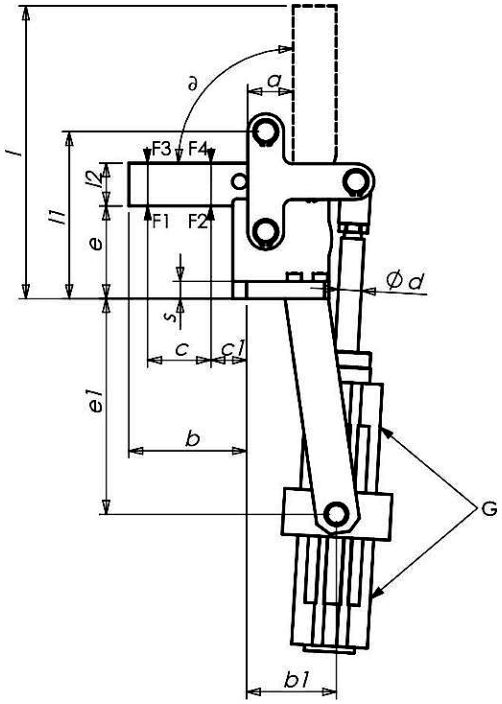

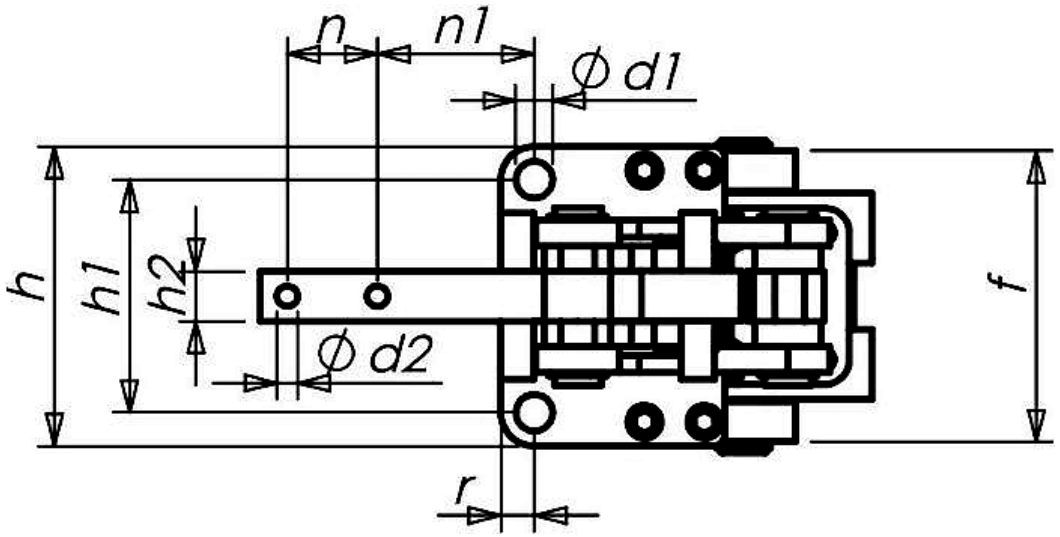

P62

Sipariş No	a	b	b1	c	c1	Ød	d1	d2	e	e1	f	h	h1	h2	l	l1	l2	n	n1	r	s	t	u	∂	silindir strok - piston çapı	g	F1 F2 (kN)	F3* F4 (kN)	F5 (kN)	hs**		g
P62/4	32	82	46	54	20	16	11	6.2	57	193	90	90	70	15	206	117	30	27	47	10	12	46	193	90°	74 - 40	G1/4	6 - 9	1.5 - 2.2	0.75	1.0	172 - 340	5100
P62/6	29	91	48	60	22	20	13	8.2	69	221	100	107	83	20	226	137	40	26	54	12	15	48	221	90°	87 - 50	G1/4	12 - 18	2.5 - 3.5	1.00	1.8	195 - 286	7250
P62/8	45	125	77	95	24.5	20	17	13.2	94	255	123	145	115	30	318	184	60	40	67	15	20	77	255	90°	120 - 63	G1/4	20	30	4.0 - 6.0	1.80	4.3	272 - 470

Çizmak Makina Sanayi

+90 212 594 40 38 • info@cizmak.com.tr

Esentepe Mah. 2959 Sk. Sultangazi Küçük Sanayi (Avizeciler) Sitesi 20.Blok No: 25A Sultangazi / İSTANBUL

Read dimensions and symbols together with the technical drawing. Price and delivery require confirmation.